Dominion Nuclear Connecticut, Inc. Millstone Power Station Rope Ferry Road Waterford, CT 06385



AUG 18 2011

U. S. Nuclear Regulatory Commission Attention: Document Control Desk

Washington, DC 20555

Serial No.

11-411

MPS Lic/LES

R0

Docket No. License No. 50-336

DPR-65

DOMINION NUCLEAR CONNECTICUT, INC. **MILLSTONE POWER STATION UNIT 2 LICENSEE EVENT REPORT 2011-002-00** MILLSTONE POWER STATION UNIT 2 REACTOR TRIP ON LOW STEAM GENERATOR **LEVEL**

This letter forwards Licensee Event Report (LER) 2011-002-00 documenting an event that occurred at Millstone Power Station Unit 2 on June 20, 2011. This LER is being submitted pursuant to 10 CFR 50.73(a)(2)(iv)(A) as an event that resulted in a manual or automatic actuation of any of the systems listed in 50.73(a)(2)(iv)(B), including the Reactor Protection System and the Auxiliary Feedwater Actuation System.

If you have any questions or require additional information, please contact Mr. William D. Bartron at (860) 444-4301.

Sincerely,

Site Vice President - Millstone

Attachments: 1

Commitments made in this letter: None

Serial No. 11-411 Docket No. 50-336 Licensee Event Report 2011-002-00 Page 2 of 2

cc: U.S. Nuclear Regulatory Commission Region I 475 Allendale Road King of Prussia, PA 19406-1415

C. J. Sanders
Project Manager - Millstone Power Station
U.S. Nuclear Regulatory Commission
One White Flint North
11555 Rockville Pike
Mail Stop 08B3
Rockville, MD 20852-2738

NRC Senior Resident Inspector Millstone Power Station

Serial No. 11-411 Docket No. 50-336 Licensee Event Report 2011-002-00

ATTACHMENT

LICENSEE EVENT REPORT 2011-002-00

MILLSTONE POWER STATION UNIT 2 DOMINION NUCLEAR CONNECTICUT, INC.

-				,												
NRC FORM (10/2010)	366 U	.S. NUCLE	AR REG	ULATORY CO	OMMI	SSION			OMB: NO				_	0/31/2013		
LICENSEE EVENT REPORT (LER)							Estimated burden per response to comply with this mandatory collection request: 80 hours. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the Records and FOIA/Privacy Service Branch (T-5 F52), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, or by internet e-mail to infocollects@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs, NEOB-10202, (3150-0104), Office of Management and Budget, Washington, DC 20503. If a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a responsit soft received to respond to the information collection.									
(See reverse for required number of digits/characters for each block)							of management and Budget, Washington, DC 20503, if a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.									
FACILITY NAME Millstone Power Station - Unit 2						2. DOCKET NUMBER 05000336				,	3. PAGE 1 OF 2					
4. TITLE	: I	. 04	0	tan Laval												
Reactor Tr	ip on Lov	v Steam	Genera	itor Levei												
5. EVENT DATE			6. LER NUMBER 7.			7. F	EPORT D	ATE				ACILITIES INVOLVED				
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REV NO.	MONTH	DAY	YEAR	·			05000	DOCKET NUMBER 05000			
06	20	2011	201	1 – 002 – 0	00	08	18	2011	FACILITY NAME			DOCKET NUMBER 05000				
11. THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check all that apply)											apply)					
9. OPE	RATING M	ODE					2203(a)(50.73(a)(2)(i)(C						
1						20.	0.2203(a)(3)(ii) 0.2203(a)(4)		50.73(a)(2)(ii)(A		A) 50.73(a)(2)(viii)(A))(viii)(A)			
						20.				50.73(a)(2)(ii)(E		B) 50.73(a)(2)(viii)(l)(viii)(B)		
			20.2203(a)(2)(i) 50			50.	36(c)(1)(i)(A)		50.73(a)(2)(iii)			50.73(a)(2)(ix)(A)			
				20.2203(a)(2)(ii) [50.	36(c)(1)(ii)(A)	Х	50.73(a))(2)(iv)(<i>F</i>	<i>a</i>)	50.73(a)(2)(x)		
10. POWER LEVEL						36(c)(2)			50.73(a)(2)(v)(A							
			20.2203(a)(2)(iv) 50				46(a)(3)(ii)					73.71(a)(5)			
	059		I				73(a)(2)(50.73(a)(2)(v)(C) OTHER						
20.2203(a)(2)(vi) 50.73(a)(2)(i)(B) 50.73(a)(2)(v)(D) Specify in Abstract below or in NRC Form 366A									t below or in							
				12.	LICE	NSEE C	ONTACT	FOR TH	IS LER							
FACILITY NAM	E								TELEPHO	NE NUME	BER (Inclu	ide Area Co	de)	:		
William D. Bartron, Nuclear Station Licensing							860-444-4301									
		13. CON	IPLETE (ONE LINE FO	R EA	CH COM	PONEN	T FAILUF	RE DESCF	RIBED IN	THIS R	EPORT				
CAUSE SYSTEM COM				PORTABL TO EPIX			SYSTEM COMPO		COMPO	ONENT MANU- FACTURER		REPORTABLE TO EPIX				
	_			FACTORER	-	TO EFIX						······································	CIONER	IOEFIX		
	İ	·	•				32.5 5-1									
14. SUPPLEMENTAL REPORT EXPECTED						TED			15. EXPECTED		MONTH	DAY	YEAR			
YES	If yes, com	EXPECTED SUBMISSION DATE)			NO NO		SUBMISSION DATE									
ABSTRACT	(Limit to 14	00 spaces.	i.e. appi	roximately 15	sinale	-spaced	tvpewriti	en lines)				<u>'</u>	·	'		
At rea to a SG ma	1152 on J ctor trippe I low suct FP in ser nual or at	lune 20, ed autom ion press vice. The utomatic	2011, whatically sure triple event actuation	vith Millstor v on low ste o on the "B' is being re on of any on also is a r	ne Po eam g ' stea porte f the	wer St generat am gen ed purs systen	ation U tor wate erator uant to ns liste	nit 2 oper level. feed pu 10 CFF d in 50.	The de mp (SG R 50.73(73(a)(2)	ecreasir FP) tha a)(2)(iv (iv)(B).	ng wate It occur)(A) as The ac	er level c rred while an ever ctuation o	ondition e placing it that re	was due I the "A" sulted in a		
				gaps in the procedure (ındamer	ntals an	d some	e proced	ure qual	ity issues		
sen the	ice at a l	ower pov on of ope	ver leve	n revised to el. Addition ndamental:	al co	rrective	e actior	ns to ad	dress th	e unde	rlying o	causes o	f the gap	s in		

NRC FORM 366A (10-2010)

LICENSEE EVENT REPORT (LER) CONTINUATION SHEET

U.S. NUCLEAR REGULATORY COMMISSION

1. FACILITY NAME	2. DOCKET		6. LER NUMBEI	3. PAGE	
Millstone Power Station - Unit 2	05000336	YEAR	SEQUENTIAL NUMBER	REV NO.	2 of 2
		2011	002	00	

NARRATIVE

1. Event Description

At 1152 on June 20, 2011, with Millstone Power Station Unit 2 operating at 59 percent power in Mode 1, the reactor tripped automatically on low steam generator (SG) water level 300 microseconds prior to a manual reactor trip initiated from the control room. The decreasing SG water level condition was due to a low suction pressure trip on the operating "B" steam generator main feedwater pump (SGFP) [SJ]. The "B" SGFP low suction pressure trip occurred while attempting to place the "A" steam generator main feedwater pump in service. Established operating procedures had recently been changed to permit starting the second SGFP at a higher power level than previously performed.

Auxiliary Feedwater (AFW) [BA] initiated as expected following loss of the operating SGFP. Standard post trip actions were carried out, and all other safety systems responded as expected.

The event is being reported pursuant to 10 CFR 50.73(a)(2)(iv)(A) as an event that resulted in a manual or automatic actuation of any of the systems listed in 50.73(a)(2)(iv)(B), including the Reactor Protection System. The actuation of the Auxiliary Feedwater Actuation System also is a reportable condition under the same paragraph.

2. Cause

The cause of the event was gaps in the application of operator fundamentals and some procedure quality issues associated with operations procedure OP 2204, Load Changes.

3. Assessment of Safety Consequences

The safety consequences of this event were low. The reactor automatically tripped on low steam generator level. Steam generator levels remained in the visible range on narrow range SG level instrumentation. All other safety systems responded as expected.

There was no loss of decay heat removal capability, because main and auxiliary feedwater pumps were available to feed the steam generators. Neither departure from nucleate boiling nor fuel centerline melt design limits were challenged. As such, there were no challenges to the fuel, reactor coolant system or containment fission product barriers.

4. Corrective Action

Procedure OP 2204 has been revised to ensure the second steam generator feedwater pump is placed in service at a lower power level. Additional corrective actions to address the underlying causes of the gaps in the application of operator fundamentals are being addressed in accordance with the station's corrective action program.

5. Previous Occurrences

No previous similar events/conditions were identified.

Energy Industry Identification System (EIIS) codes are identified in the text as [XX].